

Nikon

NIKONOS WATERTIGHT EXPOSURE-METER CASE

This case houses the Sekonic Auto-Lumi Model L-86 exposure meter, allowing its use in adverse weather or underwater, even at depths up to 50m (160 ft). The knurled knob outside the case permits operation of the encased meter.


Encasing the meter

Important: Before encasing the meter, make sure it is set to the speed of the film in use.

- (1) Place the plastic cap over the meter dial, ensuring that the cap's horizontal ridge is pointing north-south.
- (2) Turn the knurled knob on the outside of the watertight case so that the groove on the knob's underside faces north-south.
- (3) Wrap the foam plastic band around the three sides of the meter, leaving the fourth side (the translucent receptor) clear. Holding the band to the meter, insert the meter in the watertight case, ensuring that the ridge on the plastic cap engages with the groove on the underside of the knurled knob.
- (4) Place the black anti-reflection mask so that it fits snugly over the meter's translucent receptor.
- (5) Make sure that the rubber O-ring gasket remains in place as you screw on the front cap of the watertight case. Tighten the cap adequately so that it compresses the gasket and ensures watertightness.

Caution:

- (1) Avoid scratching the face of the cap and keep it clean to allow maximum penetration of light. It is a good practice to rinse the entire case in fresh, clean water after use. Alcohol or ether should not be used as cleaning agents.
- (2) Avoid leaving the meter exposed to prolonged sunlight.
- (3) Keep the O-ring gasket clean. Lubricate it lightly from time to time and ensure that the groove into which it fits is also clean.

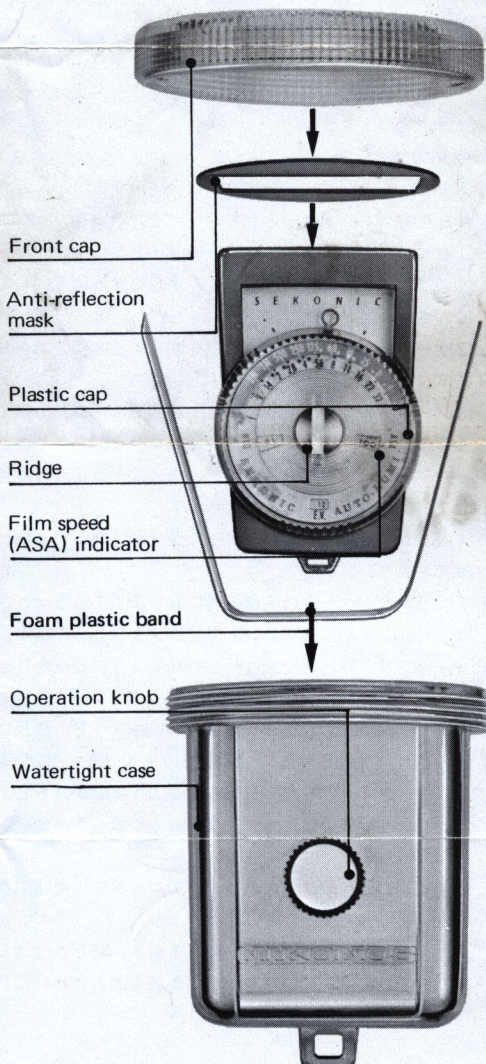

Nikon

ニコノス水中露出計容器

この容器は、セコニック社製オートルミール-86型メーター専用の防水ケースで、悪天候や水中での撮影の際に使用します。

水中では水深50mまで使用できます。メーターの操作は、ケースの外側にある操作ノブによって、ケースに入れたままで行なえます。

収納方法

メーターをケースに収納する前に、使用するフィルムのASA感度を必ずセットしておいてください。

(1)ダイヤルキャップをメーターのダイヤルにかぶせます。その際、中央にある矩形のつまみが縦になるようにしてください。

(2)ケースの外側にある操作ノブを回して、内側の溝を縦方向にセットします。

(3)メーターの、受光面を除いた3側面をスポンジの帯でくみます。手でスポンジを押さえながら、ダイヤルキャップのつまみがケースの内側の溝にはまるように注意して、メーターをケースに入れます。

(4)黒い反射防止板を、メーターの受光面にぴったり合わせてください。

(5)Oリングがケースの内側の溝におさまっているかどうかを確認してから、フロントキャップをねじ込みます。キャップは、防水が完全に行なわれるようにしっかりとめてください。

※光の透過をつねに最高に保つため、キャップの表面に傷や汚れをつけないように注意してください。使用後は、ケースの外側を水で洗っておくように心がけましょう。汚れをとる場合でも、アルコールやエーテルは絶対に使わないでください。

※露出計は、ケースに入れたまま直射日光に長時間あてないようにしてください。

※Oリングは、つねにきれいにしておき、時どき注油してください。また、Oリングをおさめる溝もきれいにしておいてください。

